



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200
Fax 613 632-5246

4

D3391-025
Job Sheet 187434



Part No: D3391-025

Job Qty: 1 ea

Part Name: Aft Tube Assembly



Part Weight: 0 lbs

Status: New

Priority: Medium

Job Created: 12/4/18

Job Tracking No:

Due Date: 1/22/19

Created By: Jesse White

Type: Stock

Description:

Note: DWG REV J SHEETS 9,10,11 IPP Rev B 06-02-07 ECN773 dwg rev. D EC IPP Rev:C 06-03-28 Update
Manuf. Instructions JLM IPP rev D 07.03.20 revF dwg EC IPP rev E 07.11.07 rev G dwg ecn 1053p EC verified
by: DD IPP Rev:F 07-11-13 ECN 1056 DD verified by: EC IPP Rev:G 08-09-10 revH as per dwg DD verified
by:EC IPP Rev:H 11.11.14 AS PER REV.I DD verified by:JLM

Ship Via:

Bill of Materials

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		Sign-off
					Setup Hrs	Run Hrs	Workcenter / Supplier	Lead Time	
90	Start up Operation	1 Ea	1/22/19	1/22/19	0.00	0.00	Start Up Crosstubes		2019-02-20 DAS
100	Mori Seiki	1 pcs	1/22/19	1/22/19	2.49	4.17	Mori Seiki TL-40		2019-02-27 66
110	QC	1 pcs	1/22/19	1/22/19	0.00	0.00	QC2-1		2019-02-27 9-89
112	QC	1 pcs	1/22/19	1/22/19	0.00	0.00	QC5		FEB 28 2019 68
120	CNC Vertical Machining	1 pcs	1/22/19	1/22/19	0.00	2.63	HAAS1-3		Kt 2019-03-14
130	QC	1 pcs	1/22/19	1/22/19	0.00	0.00	QC2 Machining-2		Kt 2019-03-14
140	QC	1 pcs	1/22/19	1/22/19	0.00	0.00	QC8 Machining-2		2019/03/17
150	Skidtubes	1 pcs	1/22/19	1/22/19	0.00	1.03	Skidtubes-4		M66
160	CNC Bend Skidtubes	1 pcs	1/22/19	1/22/19	0.00	1.33	CNC Bend Skidtube		M66
170	QC	1 pcs	1/22/19	1/22/19	0.00	0.00	QC5		BE
180	Skidtubes	1 pcs	1/22/19	1/22/19	0.00	1.03	Skidtubes-4		inb 66 DAS
190	QC	1 pcs	1/22/19	1/22/19	0.00	0.00	QC5		MAY 02 2019 68
200	HandFinish	1 pcs	1/22/19	1/22/19	0.00	0.58	HandFinish1		D.R. 19/05/2019
210	QC	1 pcs	1/22/19	1/22/19	0.00	0.00	QC7-2		M66
220	Skidtubes	1 pcs	1/22/19	1/22/19	0.00	1.41	Skidtubes-4		M66 DAS
230	QC	1 pcs	1/22/19	1/22/19	0.00	0.00	QC5		MAY 16 2019 68
235	HandFinish	1 pcs	1/22/19	1/22/19	0.00	0.58	HandFinish2		MAY 22 2019
240	SprayPaint	1 pcs	1/22/19	1/22/19	0.00	0.25	Spray Paint		AR 19-5-24
242	Outsource	1 pcs	1/22/19	1/22/19			ATE003-VC		NR
250	QC	1 pcs	1/22/19	1/22/19	0.00	0.00	QC14		M 14-6-1
260	HandFinish	1 pcs	1/22/19	1/22/19	0.00	0.58	HandFinish4		M 14-6-1 DAS
270	QC	1 pcs	1/22/19	1/22/19	0.00	0.00	QC5		JUN 01 2019 68
280	Packaging	1 pcs	1/22/19	1/22/19	0.00	0.00	Packaging3-1		DAS 21 JUN 10 2019 9-89
290	QC21-SA	1 Ea	1/22/19	1/22/19	0.00	0.00	QC21		JUN 10 2019

Part Op 100 - Turn as per Folio FA599 Rev: J & Dwg D3391 Rev: J ***ensure steady rest is turning true*** **REMOVE
 Descriptions: STEADY REST AND MACHINIG MARKS****

120 - 1-Machine as per Folio FA 599 Rev: J & Dwg D3391 Rev: J

140 - ***INSPECT INSIDE BORE***

150 - 1-Drill (PILOT HOLE) aft cap holes per Dwg D3391 using DT8803

160 - Form as per Dwg D3391 Using Bend Prog 3391025

180 - 1-Open Aft cap pilot hole to .208" as per Dwg D3391 2-Drill float bag holes using DT8809 as per Dwg D3391(Holes marked "A" Only. 3-Drill wearplate holes as per Dwg D3391 using DT8878(Mid Tube) & DT8217 Wearplate Jig . *****Do Not Open To Finished Size***** 4-Drill Wearshoe holes as per DWG D3391 using DT8939 locating from 2 previously drilled aft wearplate holes. 5-Open wearplate holes to 0.297" and c'bore as per dwg D3391 6-Open up all float bag holes to 0.328" and c'sink as per Dwg D3391. 8- Scribe batch # on fwd end

220 - 1- Instal spacers as per dwg D3391 A/R Magnabond 6398 Batch: S146436 exp. date: 19-10-31 cure time 12hrs as per QSI0015 2- Grind crossbolts flush 3- Back drill using #9 drill 4- Touchup Magnabond 5- Deburr

235 - AND REALODINE AS PER PAR09-043

240 - PRIME AS PER DWG AND QSI005 4.2.1.3.3 Primer S163577 Paint S179047

260 - 1-Install inserts as per Dwg D3391 2-Install Aft Cap as per Dwg D3391 A/ R Sikaflex-241/-291

Sikaflex expiry date: 3- INSTALL WEARPLATES AS PER DWG

290 - 5- Detail DD, open (5) forward wearplate holes 0.375", then use DT10247 and drill holes for nutplates and c'sink. 6- Open wearplate holes to 0.297" and c'bore as per dwg D3391. ***SIX FARTHEST AFT HOLES ONLY*** 7-Open up all float bag holes to 0.328" and c'sink as per Dwg D3391. 8-Deburr 9- Scribe batch # on fwd end

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Cross tube ☐</td> <td>Eng. (Non-AW) ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Water Jet ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Supplier Quality ☐</td> </tr> </table>				Skid-tube ☐	Cross tube ☐	Eng. (Non-AW) ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Water Jet ☐	Large Fab ☐	Finishing ☐	Rec/Store/Packaging ☐	Supplier Quality ☐																																
Skid-tube ☐	Cross tube ☐	Eng. (Non-AW) ☐	Engineering ☐																																														
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Water Jet ☐																																														
Large Fab ☐	Finishing ☐	Rec/Store/Packaging ☐	Supplier Quality ☐																																														
Date :	Sequence #:	QTY Affected :		MRB (QSI042)																																													
Description Work Order Deviation			Disposition																																														
			Completed By																																														
			Lead hand / Supervisor																																														
			QC / QA Coordinator																																														
Root Cause <table style="width: 100%;"> <tr><td>Operator</td><td>☐</td></tr> <tr><td>Manufacturing Process</td><td>☐</td></tr> <tr><td>Equip/Tooling</td><td>☐</td></tr> <tr><td>Handling/Presservation</td><td>☐</td></tr> <tr><td>Material</td><td>☐</td></tr> <tr><td>Product Improvement</td><td>☐</td></tr> <tr><td>Process Improvement</td><td>☐</td></tr> <tr><td>Human Factors</td><td>☐</td></tr> </table>		Operator	☐	Manufacturing Process	☐	Equip/Tooling	☐	Handling/Presservation	☐	Material	☐	Product Improvement	☐	Process Improvement	☐	Human Factors	☐	FAULT CATEGORY <table style="width: 100%;"> <tr> <td>☐ Pressure/Forced</td> <td>☐ Contamination</td> <td>☐ Power Loss/Surge</td> <td>☐ Positioned Wrong</td> </tr> <tr> <td>☐ Bending</td> <td>☐ Misaligned/off center</td> <td>☐ Folio/Program</td> <td>☐ Outside Tolerance</td> </tr> <tr> <td>☐ Crushing</td> <td>☐ BOM/Route</td> <td>☐ Grain Direction</td> <td>☐ Drawing</td> </tr> <tr> <td>☐ Cracks</td> <td>☐ Broken/Damage/Defect</td> <td>☐ Weld</td> <td>☐ Finish</td> </tr> <tr> <td>☐ Crimp/Kink/Ripple/Wave/Twist</td> <td>☐ Incomplete/Unclear Instructions</td> <td>☐ Wrong Stock Pulled</td> <td>☐ Part Lost/Missing</td> </tr> <tr> <td>☐ Marks/Chatter</td> <td>☐ Drill Holes</td> <td>☐ Out of Sequence</td> <td>☐ Misread</td> </tr> <tr> <td>☐ Mislabeled</td> <td>☐ Fit/Function</td> <td>☐ Off-set/Set-up</td> <td></td> </tr> </table>				☐ Pressure/Forced	☐ Contamination	☐ Power Loss/Surge	☐ Positioned Wrong	☐ Bending	☐ Misaligned/off center	☐ Folio/Program	☐ Outside Tolerance	☐ Crushing	☐ BOM/Route	☐ Grain Direction	☐ Drawing	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Finish	☐ Crimp/Kink/Ripple/Wave/Twist	☐ Incomplete/Unclear Instructions	☐ Wrong Stock Pulled	☐ Part Lost/Missing	☐ Marks/Chatter	☐ Drill Holes	☐ Out of Sequence	☐ Misread	☐ Mislabeled	☐ Fit/Function	☐ Off-set/Set-up	
Operator	☐																																																
Manufacturing Process	☐																																																
Equip/Tooling	☐																																																
Handling/Presservation	☐																																																
Material	☐																																																
Product Improvement	☐																																																
Process Improvement	☐																																																
Human Factors	☐																																																
☐ Pressure/Forced	☐ Contamination	☐ Power Loss/Surge	☐ Positioned Wrong																																														
☐ Bending	☐ Misaligned/off center	☐ Folio/Program	☐ Outside Tolerance																																														
☐ Crushing	☐ BOM/Route	☐ Grain Direction	☐ Drawing																																														
☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Finish																																														
☐ Crimp/Kink/Ripple/Wave/Twist	☐ Incomplete/Unclear Instructions	☐ Wrong Stock Pulled	☐ Part Lost/Missing																																														
☐ Marks/Chatter	☐ Drill Holes	☐ Out of Sequence	☐ Misread																																														
☐ Mislabeled	☐ Fit/Function	☐ Off-set/Set-up																																															
Other/Details:																																																	

Job BOM

Part / Item	Component Name	Quantity	Operation	Container
D6014-090	Aluminum Extrusion	1 Ea (1 ea)	90-Start up Operation	F139427
D3670-4-200	Bushing	4 Ea (4 ea)	220-Skidtubes	S123086
ALS4-1032-130	Rivnut	8 Ea (8 ea)	260-HandFinish	S057257
ALS4-1032-225	Rivnut	4 Ea (4 ea)	260-HandFinish	S167517
AN3C4A	Bolt	6 Ea (6 ea)	260-HandFinish	S143675
AN3C5A	Bolt	4 Ea (4 ea)	260-HandFinish	S176452
D2646	Aft Cap	1 Ea (1 ea)	260-HandFinish	S160607
D3672-1	Washer, Phenolic	2 Ea (2 ea)	260-HandFinish	F164002
D4095-047	Wearpad Aft	1 Ea (1 ea)	260-HandFinish	S070710
D4095-049	Wearpad Aft	1 Ea (1 ea)	260-HandFinish	S118507
MS20601-AD4W3	Rivet	12 Ea (12 ea)	260-HandFinish	S160312
MS20601-AD4W7	Rivet	8 Ea (8 ea)	260-HandFinish	S147039
MS21075L5	Nut Plate	10 Ea (10 ea)	260-HandFinish	S093726
NAS1149C0332R	Washer	10 Ea (10 ea)	260-HandFinish	S156079

Job Allocations

010148

Operation	Component Part	Required	Inventory	Allocated
90-Start up Operation	D6014-090	1	4	0
220-Skidtubes	D3670-4-200	4	48	0
260-HandFinish	ALS4-1032-130	8	11,083	0
	ALS4-1032-225	4	1,280	0
	AN3C4A	6	1,647	0
	AN3C5A	4	1,492	0
	D2646	1	42	0
	D3672-1	2	1,403	0
	D4095-047	1	33	0
	D4095-049	1	25	0
	MS20601-AD4W3	12	501	0
	MS20601-AD4W7	8	33	0
	MS21075L5	10	310	0
	NAS1149C0332R	10	3,437	0

Part Specifications

Specifications could not be found.

Plex 12/4/18 11:35 AM dart.white.jesse

DART
AEROSPACE

Container No: S155255



Part: D3391-025

Job No: 187434

Serial No/Batch: S155255

Revision:

Inspector:

Exp Date:

Instructions: Various STC's

Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K64 1K7
CANADA
TEL.: 1 813 632-5200
Email: sales@dartaero.com
www.dartaerospace.com

Date: 02/20/19

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

④

DART AEROSPACE LTD		Work Order: 187434
Description: Float Skidtube (412)		Part Number: D3391-3
Inspection Dwg: D3391	Rev: J	Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
Lathe Section						
14.000	+/-0.010	14.000	✓		Tape	
3.500	+/-0.010	3.499	✓		CNC-08	
Ø3.200	+/-0.010	3.207	✓		CNC-05	
Ø3.750	+/-0.010	3.751	✓		CNC-05	
30° x 0.060 chamfer	+/-0.010	.062	✓		CNC-08	
88.93	+/-0.030	88.93	✓		Tape	

Measured by: DAS 66 M.D	Date: 2019-02-27
Audited by: 9-89 68	Date: FEB 28 2019

HAAS Section						
1.526	+0.000/-0.030	1.505	✓			
7.500	+/-0.010	7.500	✓		Kt-05	Veri.
27.750	+/-0.010	27.750	✓		Tape	
31.750	+/-0.010	31.750	✓		Tape	
35.250	+/-0.010	35.250	✓			
3.300	+/-0.010	3.297	✓		Kt-05	Veri.
0.200	+/-0.010	0.200	✓		Kt-05	Veri.
3.520	+/-0.010	3.525	✓		SL	Micronetre
0.687	+0.010/-0.000	0.690	✓		Kt-05	Veri.
R0.062	+/-0.010	0.0625	✓		R-G	
Ø0.484	+0.005/-0.001	Ø0.484	✓		Kt-05	Veri.

Measured by: Kt. 1	Date: 2019-03-14
Audited by: 9-89	Date: 19/03/17

Rev	Date	Change	Revised by	Approved
A	06.04.24	New Issue P/O D3391-015/-025	KJ/JLM	
B	06.06.19	Dwg revision update	KJ/JLM	
C	07.04.20	Ø0.208 dimension removed	KJ/JLM	
D	07.09.06	0.400 dimension removed	KJ/JLM	
E	07.11.23	Dwg Rev. updated	KJ/EC/DD	
F	09.04.27	Dimensions updated per Rev H and NCR09-028	KJ/JLM	
G	09.11.16	Dimension 0.200 removed	KJ	
H	11.06.21	Dimension 44.995 removed	KJ	
I	12.05.15	Dwg Rev updated	KJ	
J	12.05.23	Dimension updated	KJ	
K	12.10.15	88.93 dimension removed	KJ	
L	12.11.28	88.93 dimension added	KJ	
M	16.06.23	Dimensions updated per Rev J	KJ	

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

D3391-041/-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY -041	QTY -043	PART NUMBER	DESCRIPTION
X		D3391-041	FLOAT SKIDTUBE ASSEMBLY
	X	D3391-043	FLOAT SKIDTUBE ASSEMBLY
1		D3391-011	FWD TUBE ASSEMBLY
1		D3391-013	MID TUBE ASSEMBLY
1		D3391-015	AFT TUBE ASSEMBLY
	1	D3391-021	FWD TUBE ASSEMBLY
	1	D3391-023	MID TUBE ASSEMBLY
	1	D3391-025	AFT TUBE ASSEMBLY
2	2	D3591-1	BUSHING
4		D3672-3	WASHER
1	1	D4095-041	WEARSHOE
1	1	D4095-043	WEARSHOE
1	1	D4095-045	WEARSHOE
1	1	D4095-047	WEARPAD
1	1	D4095-049	WEARPAD
1	1	D4095-051	WEARSHOE
24	24	AN3C4A	BOLT
4	4	AN3C6A	BOLT
10	10	AN5C7A	BOLT
28	28	NAS1149C0332R	WASHER
10	10	NAS1149C0532R	WASHER
4		MS27039C4-12	SCREW
4		NAS1149C0432R	WASHER

△

J	INCORPORATED DSI 9733, REFORMAT DRAWING CHANGED CBORE DEPTH (ZN D2-8, D2-9), REVISED TABLES, REPLACED POWDER COAT WITH PAINT	ML	16.01.14
I	REMOVE GASKETS AND REPLACE ALL WEARSHOES; PARTS LIST UPDATE, ZN A8-1, ZN A8-2, ZN A8-4, ZN B6-8; LPS-3 COATING REMOVED FROM NOTE 2, ZN A3-1, ZN A3-2, REMOVED INSERT AELS-1032-130, ZN B6-4, B2-4, C7-8, C3-8; REMOVED HOLES, ZN D6-4 ZN D2-4, ZN D7-8, ZN D3-8	XDF	11.10.13
H	DRAWING UPDATED TO CURRENT STANDARDS. SHT 1 PL ADDED D3591-1 BUSHING. ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. SHT 2 PL ADDED D3591-1 BUSHING. ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. (FOR FURTHER INFO SEE DSI 9364 & NCR 08-074)	AJS	08.08.20
G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	08.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	08.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
REV	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE USA, INC EUGENE, OR	
DRAWN	ML		
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.	LP	D3391	SHEET 1 OF 11
APPROVED	BP	TITLE	SCALE
DE APPR.	JP	412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

RELEASED
2016-04-28
ECN 16-516

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

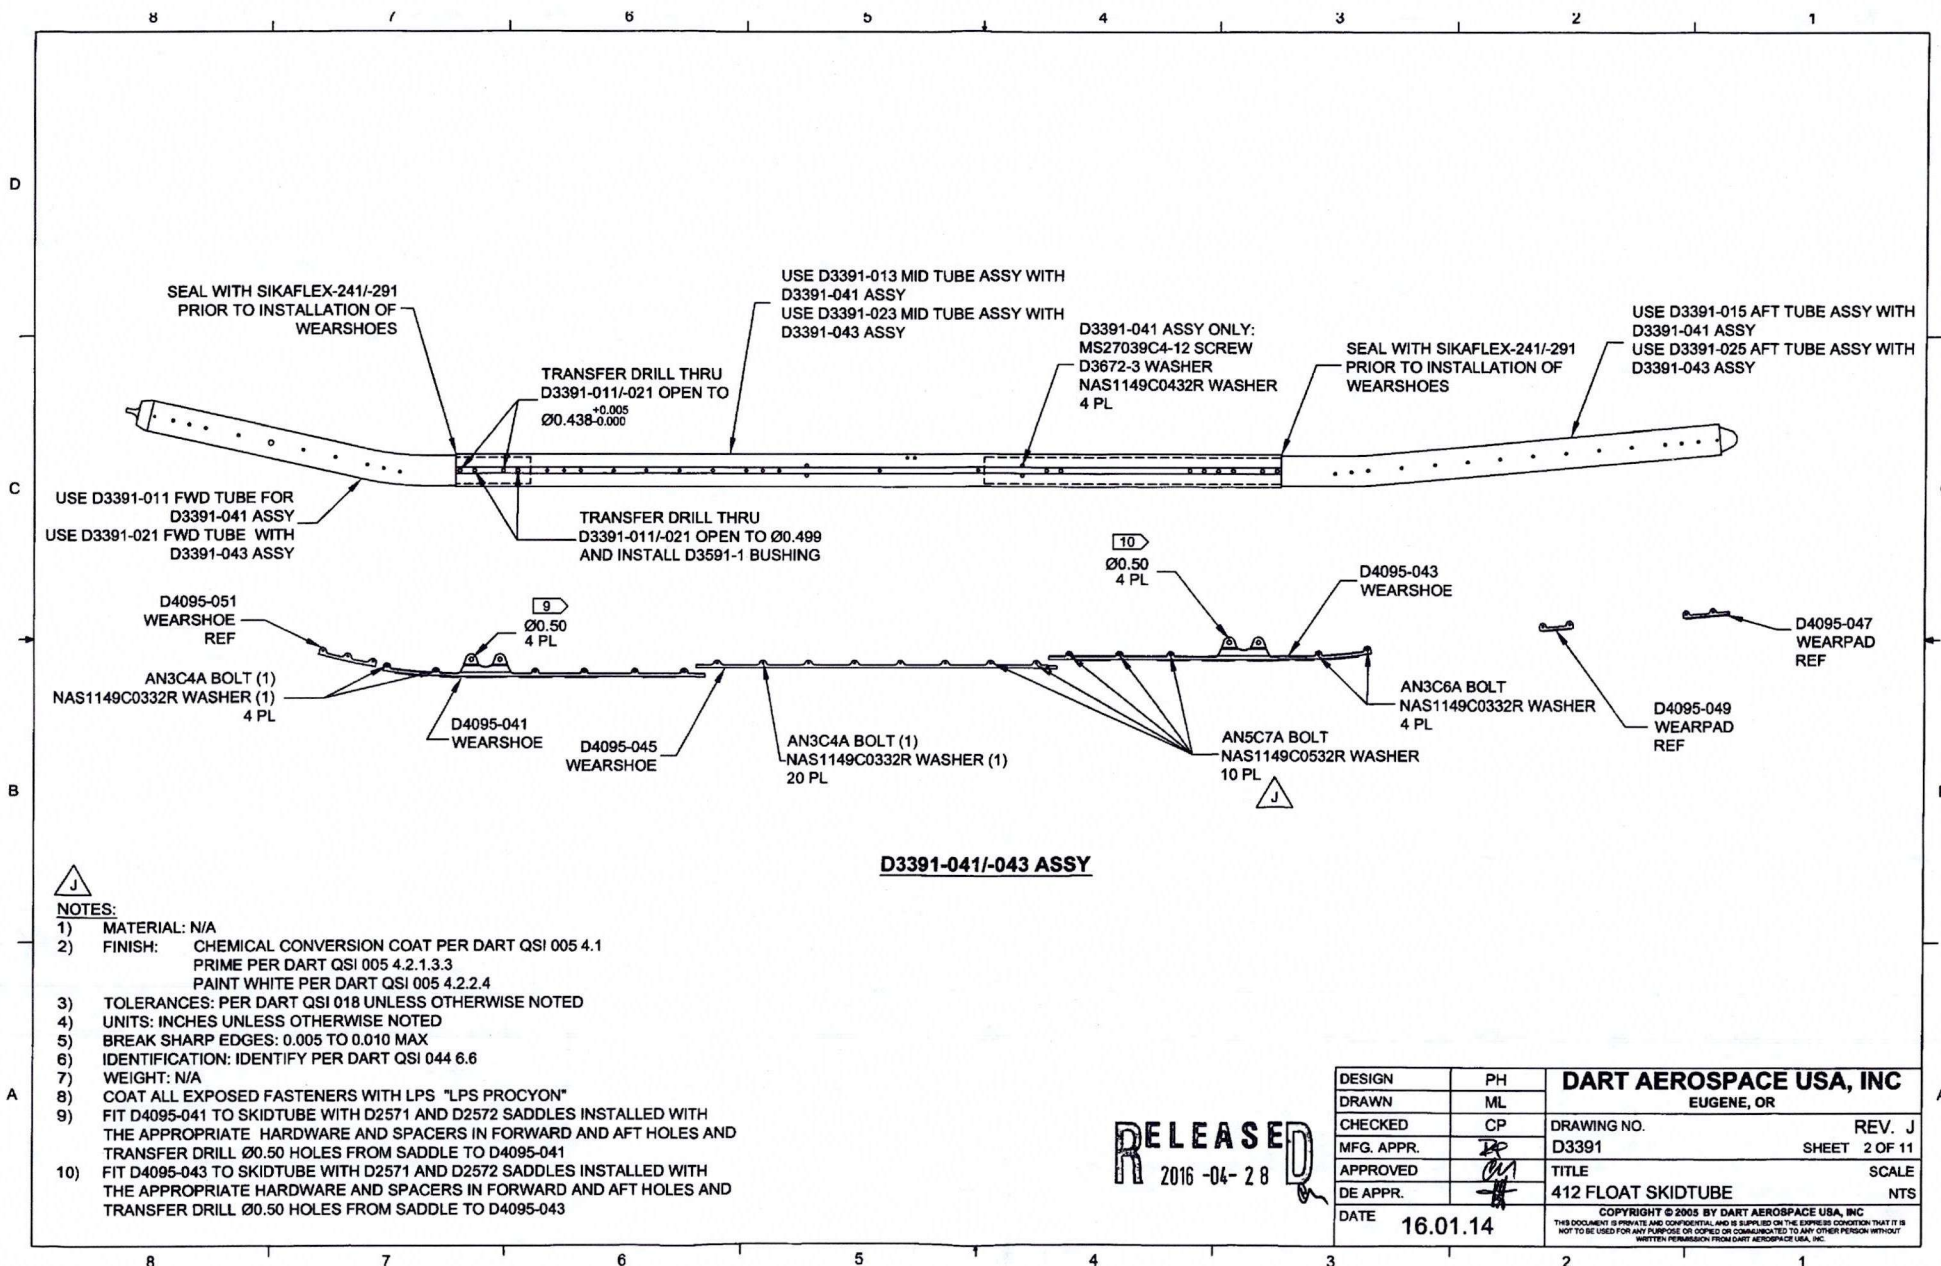

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

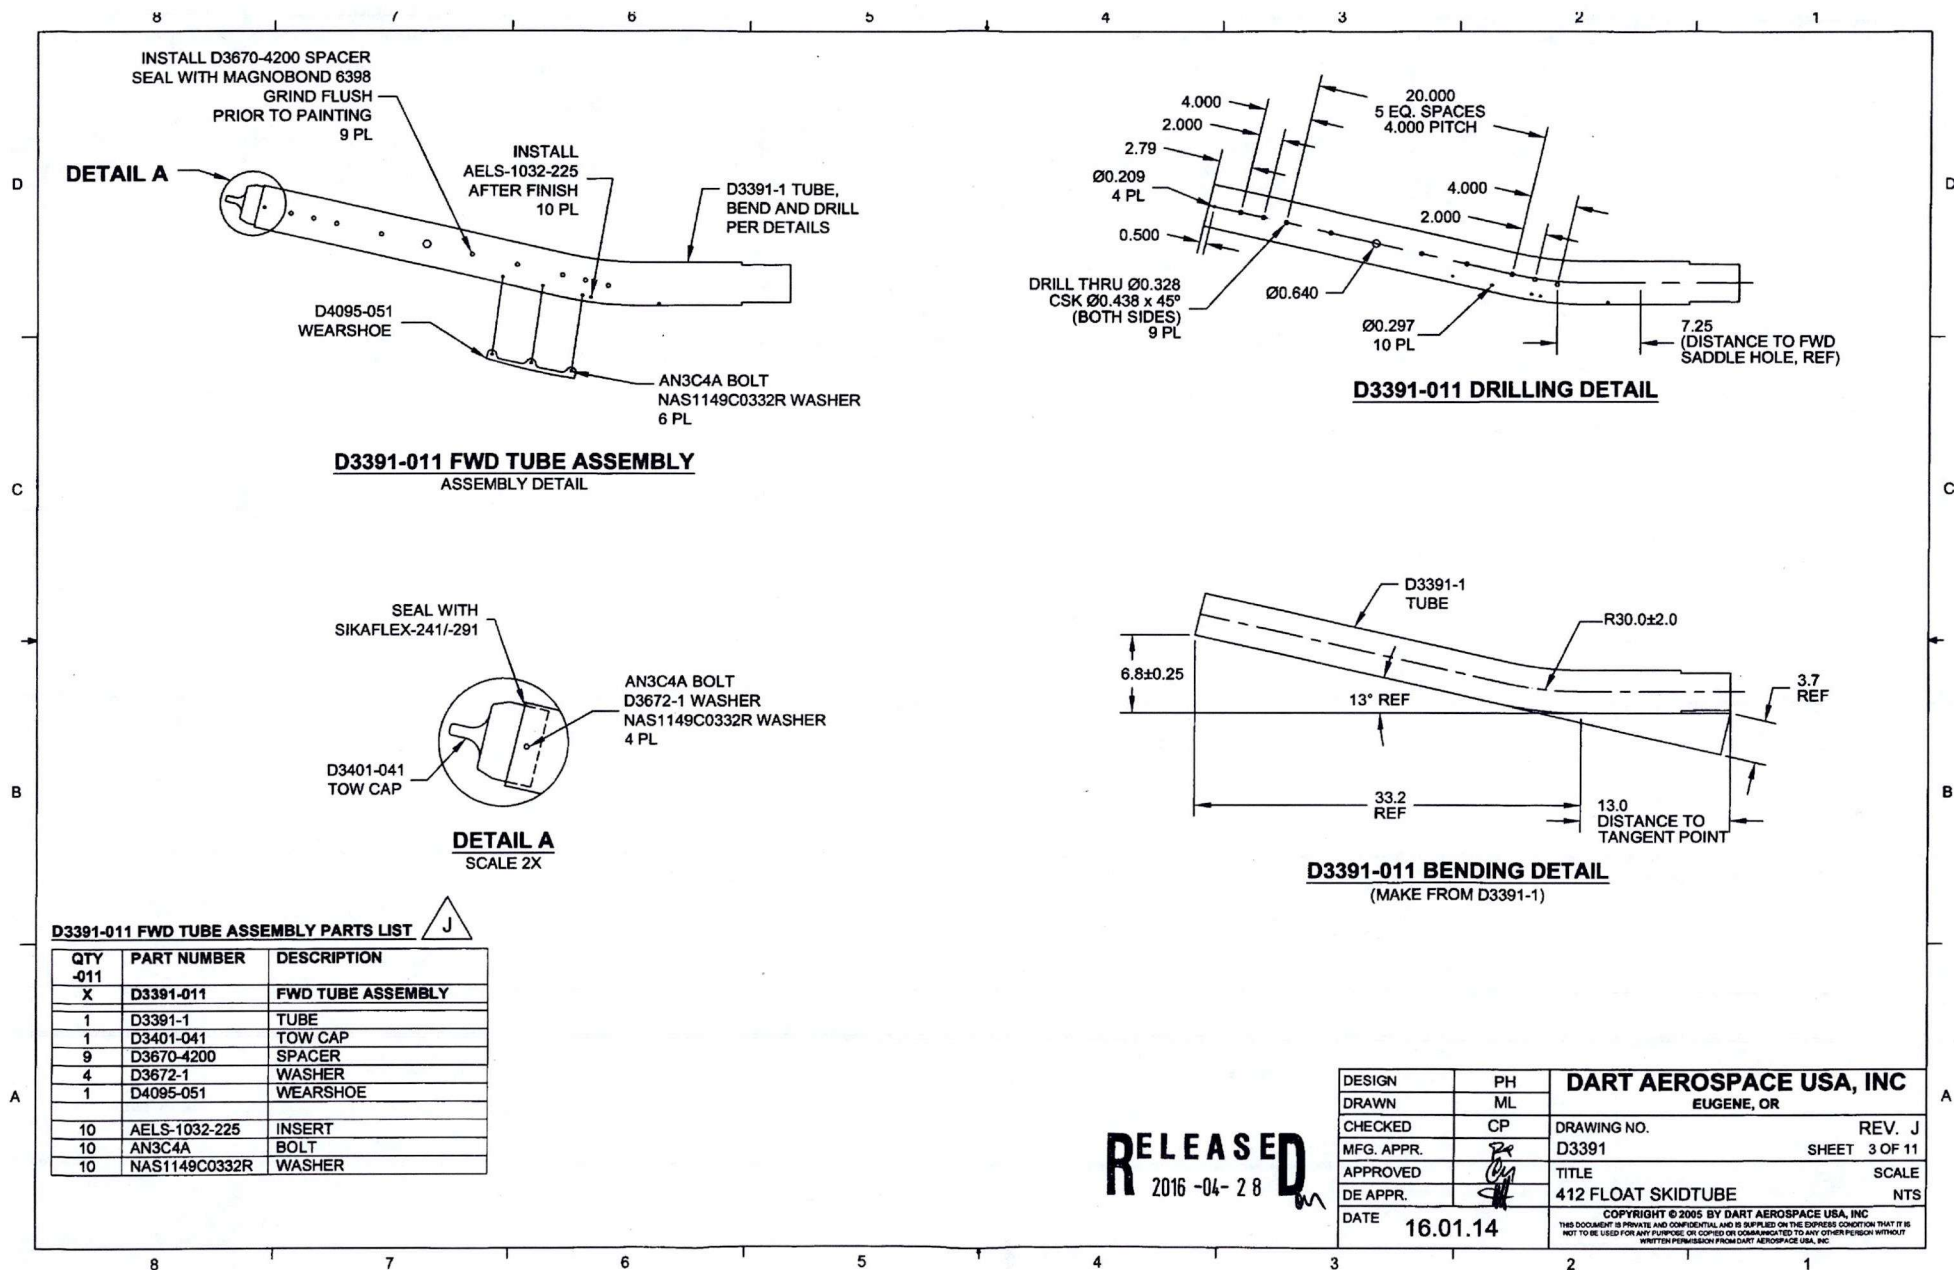

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

INSTALL D3670-4200 SPACER
SEAL WITH MAGNOBOND 6398
GRIND FLUSH
PRIOR TO PAINTING
4 PL

DETAIL B



INSTALL
AELS-1032-225
AFTER FINISH
10 PL

D4095-051
WEARSHOE

AN3C4A BOLT
NAS1149C0332R WASHER
6 PL

D3391-021 FWD TUBE ASSEMBLY ASSEMBLY DETAIL

SEAL WITH
SIKAFLEX-241/-291

D3401-041
TOW CAP


DETAIL B SCALE 2X

AN3C4A BOLT
D3672-1 WASHER
NAS1149C0332R WASHER
4 PL


J

D3391-021 FWD TUBE ASSEMBLY PARTS LIST

QTY -021	PART NUMBER	DESCRIPTION
X	D3391-021	FWD TUBE ASSEMBLY
1	D3391-1	TUBE
1	D3401-041	TOW CAP
4	D3670-4200	SPACER
4	D3672-1	WASHER
1	D4095-051	WEARSHOE
10	AELS-1032-225	INSERT
10	AN3C4A	BOLT
10	NAS1149C0332R	WASHER

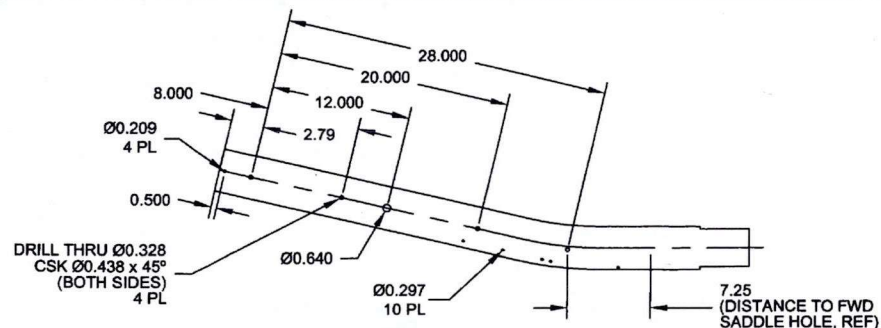

D3391-021 DRILLING DETAIL

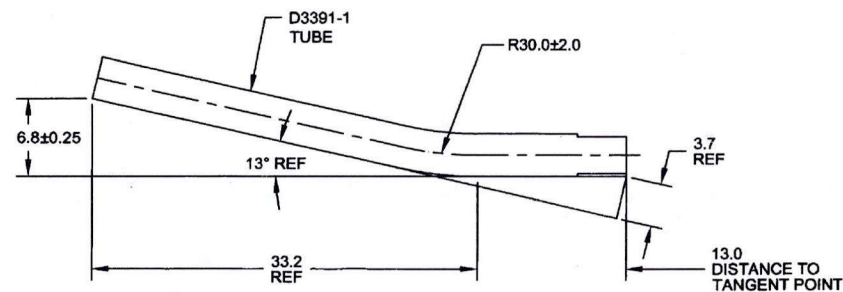

D3391-021 BENDING DETAIL (MAKE FROM D3391-1)

RELEASED
2016-04-28

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.	DE	D3391	SHEET 4 OF 11
APPROVED	DE	TITLE	SCALE
DE APPR.	DE	412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMBINATION TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE


NCR No. _____

Route update only ☐


Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

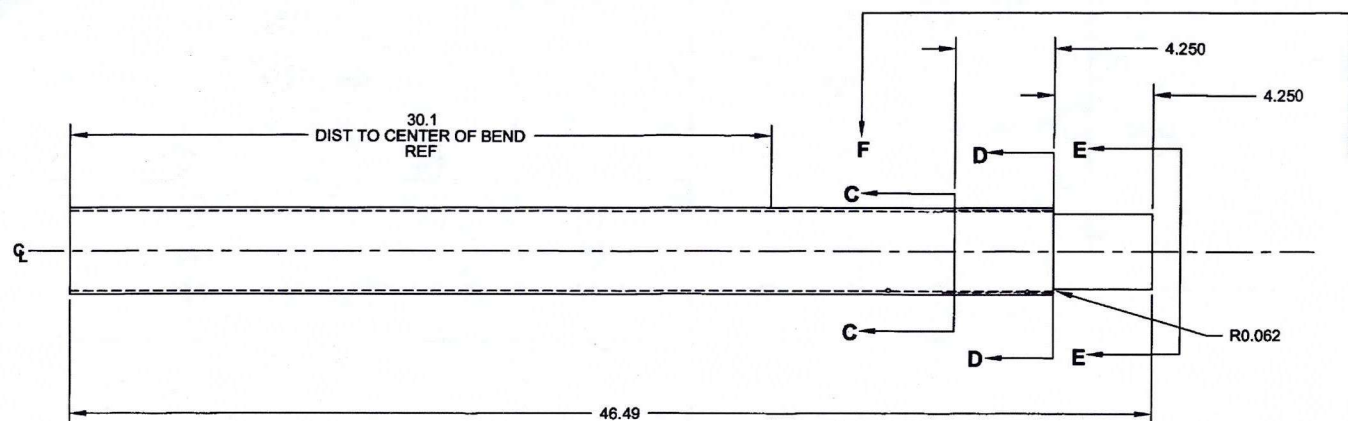


D3391-1 TUBE
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

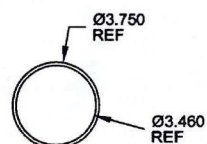


SECTION C-C

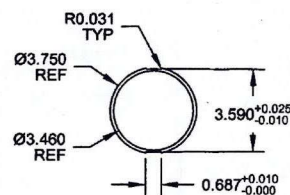

SECTION D-D

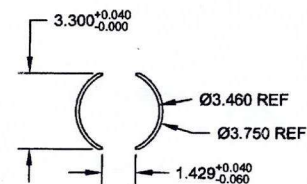

SECTION E-E

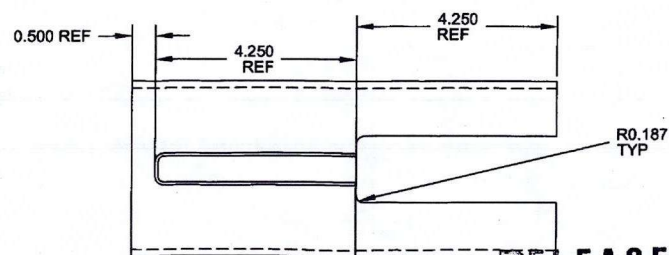

VIEW F-F
SCALE 2X

RELEASED
2016-04-28

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.	<i>CP</i>	D3391	SHEET 5 OF 11
APPROVED	<i>CP</i>	TITLE	SCALE
DE APPR.	<i>CP</i>	412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE


NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042) _____	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details: _____					

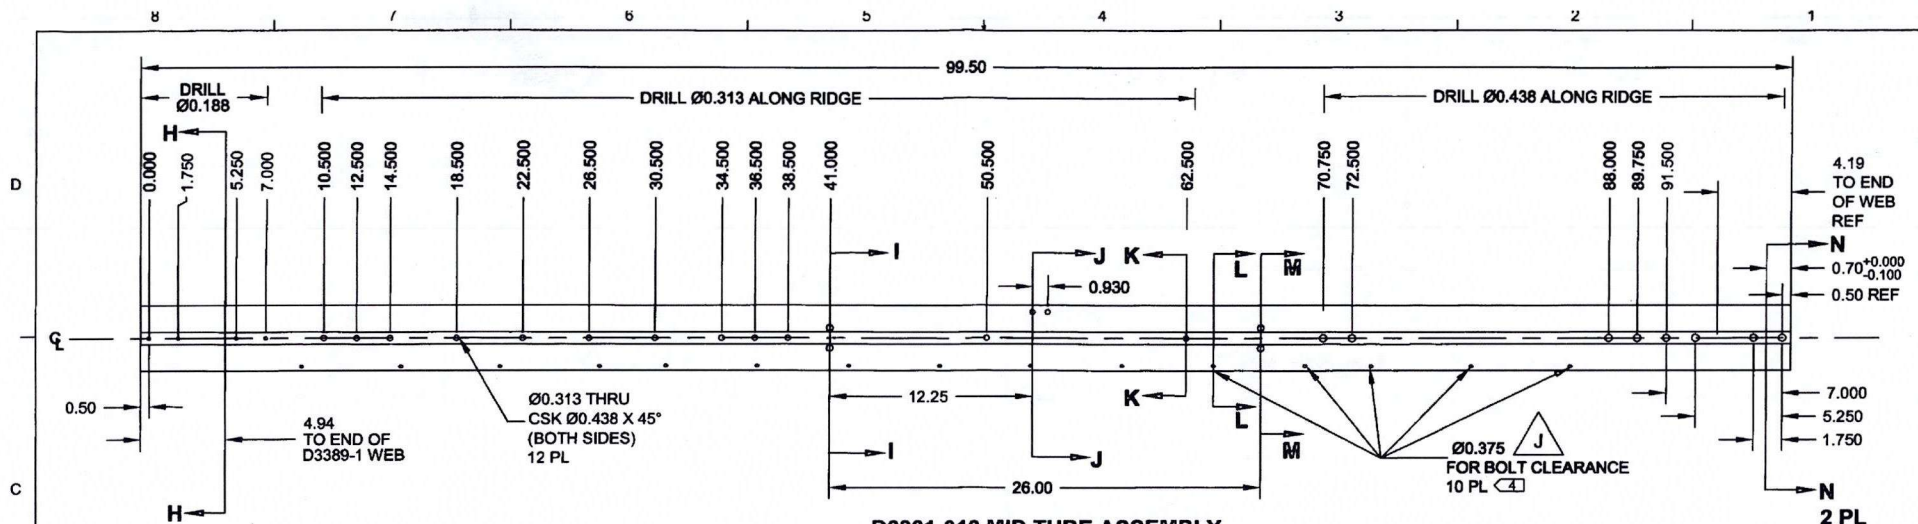

D3391-013 MID TUBE ASSEMBLY

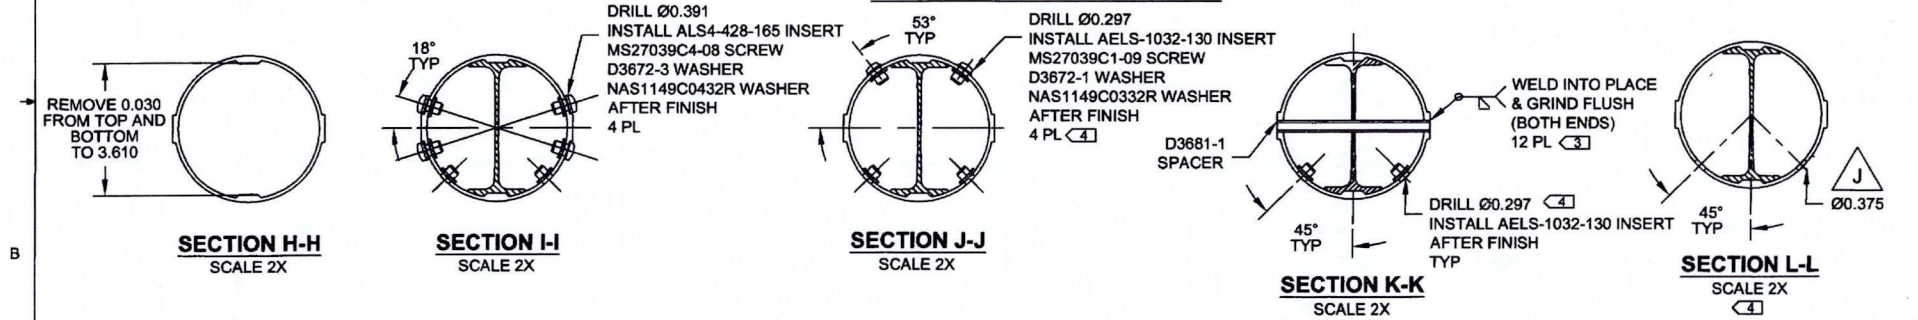

D3391-013 MID TUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
X	D3391-013	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
4	D3672-1	WASHER
4	D3672-3	WASHER
12	D3681-1	SPACER
24	AELS-1032-130	INSERT
4	ALS4-428-165	INSERT
4	MS27039C1-09	SCREW
4	MS27039C4-08	SCREW
4	NAS1149C0332R	WASHER
4	NAS1149C0432R	WASHER



D3391-013 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/-291 PER QSI 015
- 3) WELDING: PER DART QSI 004
- 4) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 AND Ø0.375 HOLES FOR WEARSHOE INSERTS AND NUTPLATES. CBOR AS NOTED AND INSTALL INSERT/NUTPLATES EXCEPT WHERE INDICATED.

DESIGN	PH	DART AEROSPACE USA, INC EUGENE, OR	
DRAWN	ML		
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.		D3391	SHEET 6 OF 11
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

RELEASED
2016-04-28

Entered: _____ Date: _____





WORK ORDER NON-CONFORMANCE / ROUTE UPDATE


NCR No. _____

Route update only ☐


Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

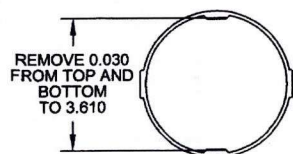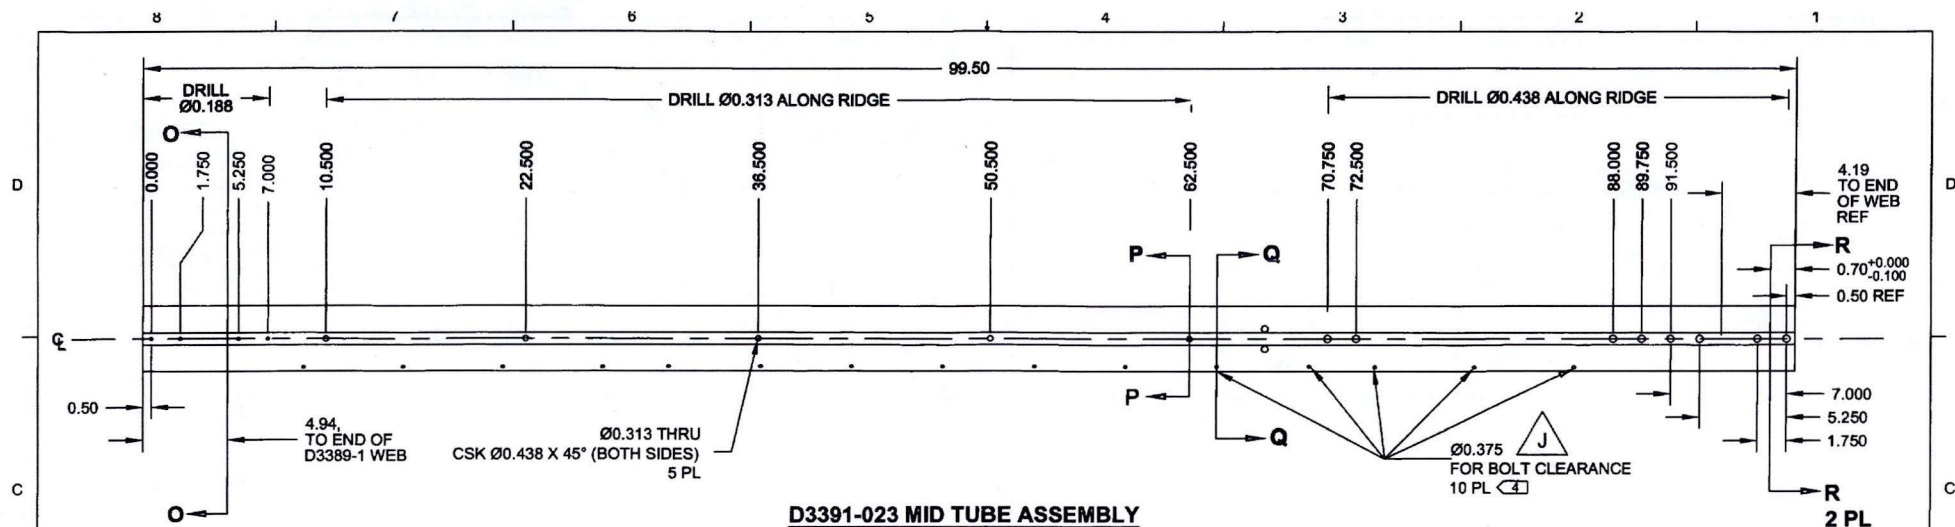


SECTION O-O
SCALE 2X

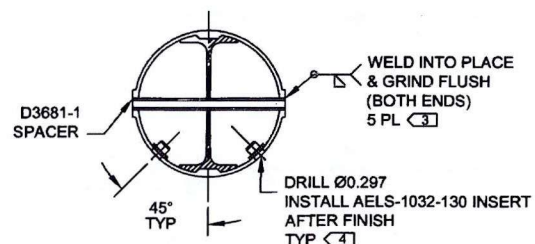

SECTION P-P
SCALE 2X

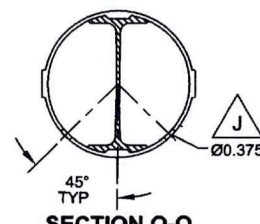

SECTION Q-Q
SCALE 2X <4>

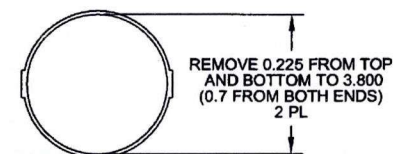

SECTION R-R
SCALE 2X

D3391-023 MID TUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
-023		
X	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT



D3391-023 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/-291 PER QSI 015
- 3) WELDING: PER DART QSI 004
- 4) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 AND Ø0.375 HOLES FOR WEARSHOE INSERTS AND NUTPLATES. CBOR AS NOTED AND INSTALL INSERT/NUTPLATES EXCEPT WHERE INDICATED.

DESIGN	PH	DART AEROSPACE USA, INC EUGENE, OR	
DRAWN	ML		
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.		D3391	SHEET 7 OF 11
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

RELEASED
2016-04-28

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details: _____					

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

INSTALL MS21075L5 NUT PLATE
USING MS20601AD4 RIVETS
(SEE SECTION T-T ON SHT 10)
10 PL

D3391-025 AFT TUBE ASSEMBLY

INSTALL D3670-4200 SPACER
SEAL WITH MAGNOBOND 6398
GRIND FLUSH
PRIOR TO PAINTING, 4 PL

DETAIL U
C2-11


CBORE Ø0.430 X 0.170
THEN INSTALL
AELS-1032-225
4 PL 2 4

CBORE Ø0.430 X 0.120
THEN INSTALL
AELS-1032-130
4 PL 2 3

INSTALL AELS-1032-130
4 PL 2 3

D4095-049
WEARPAD
AN3C5A BOLT
NAS1149C0332R WASHER
4 PL

D4095-047
WEARPAD
AN3C4A BOLT
NAS1149C0332R WASHER
4 PL

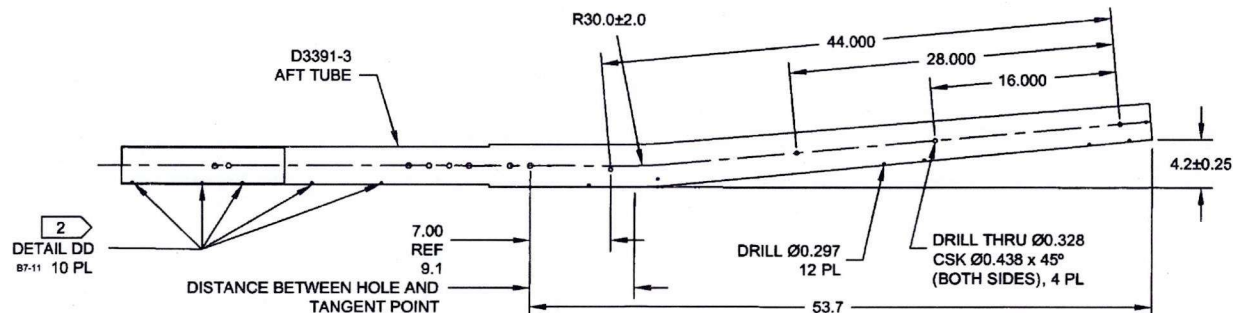

BENDING AND DRILLING DETAIL

D3391-025 AFT TUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
X	D3391-025	AFT TUBE ASSEMBLY
1	D2646	AFT CAP
1	D3391-3	AFT TUBE
4	D3670-4200	SPACER
2	D3672-1	WASHER
1	D4095-049	WEARPAD
1	D4095-047	WEARPAD
8	AELS-1032-130	INSERT
4	AELS-1032-225	INSERT
6	AN3C4A	BOLT
4	AN3C5A	BOLT
20	MS20601AD4	RIVET, BLIND
10	MS21075L5	NUT PLATE FLOATING
10	NAS1149C0332R	WASHER

NOTES:

- 1) COAT ALL EXPOSED FASTENERS WITH LPS "LPS PROCYON"
- 2) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 AND Ø0.375 HOLES FOR WEARSHOE INSERTS AND NUTPLATES. CBORE AS NOTED AND INSTALL INSERT/NUTPLATES EXCEPT WHERE INDICATED. USE NUT PLATE DRILL JIG IF REQUIRED.
- 3) ENSURE WALL THICKNESS IS BETWEEN 0.070 AND 0.130 BEFORE INSTALLING INSERT
- 4) ENSURE WALL THICKNESS IS BETWEEN 0.130 AND 0.225 BEFORE INSTALLING INSERT

RELEASED
2016-04-28

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.		D3391	SHEET 9 OF 11
APPROVED		TITLE	SCALE
DE APPR.		AFT TUBE ASSEMBLY	NTS
DATE	16.01.14	COPYRIGHT © 2006 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC			

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

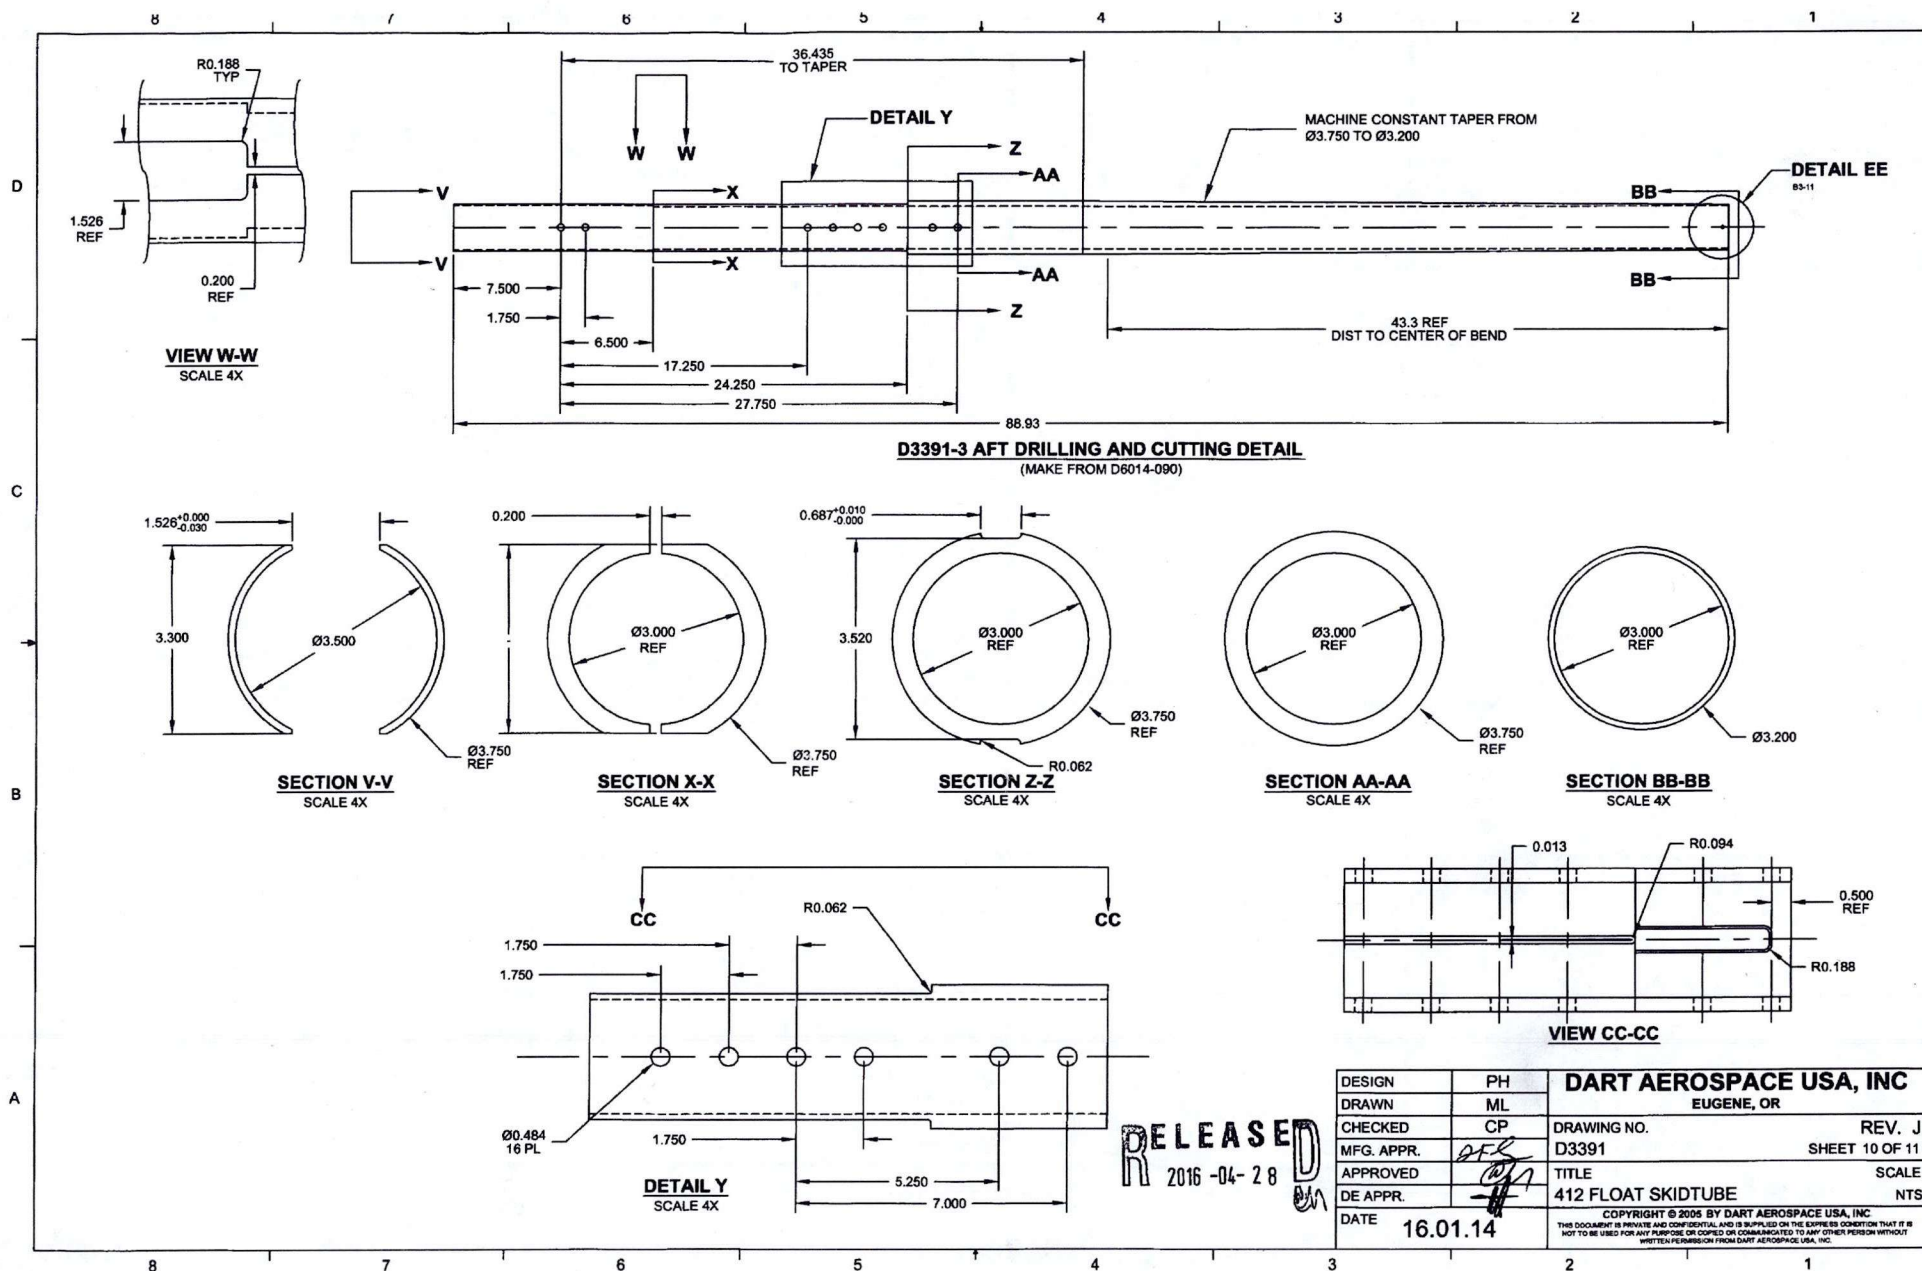

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

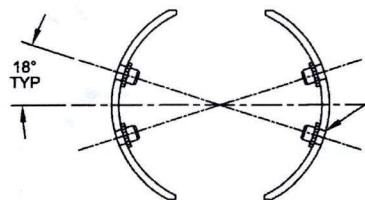


SECTION S-S
SCALE 5X


DRILL Ø0.391
CBORE Ø0.516 X 0.040 DEEP
INSTALL ALS4-428-165 INSERT
4 PL

USE DT8217 DRILL TEMPLATE
TO LOCATE HOLES AND OPEN
TO Ø0.375


MS21075L5 NUTPLATE
REF

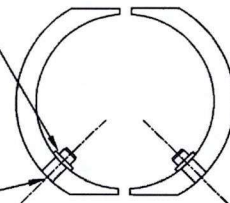


SECTION T-T
SCALE 5X
5 PL

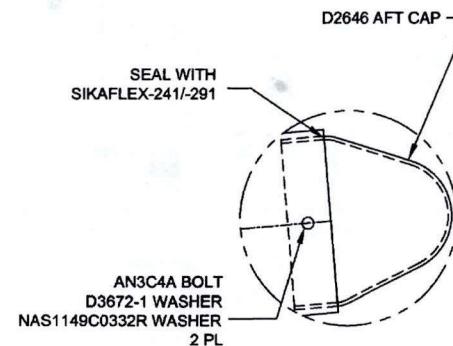

DETAIL U
SCALE 5X

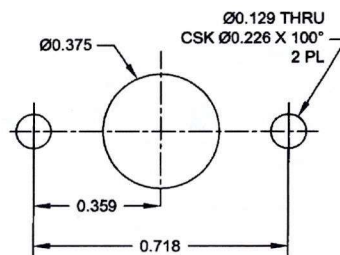

DRILLING DETAIL DD
SCALE 10X

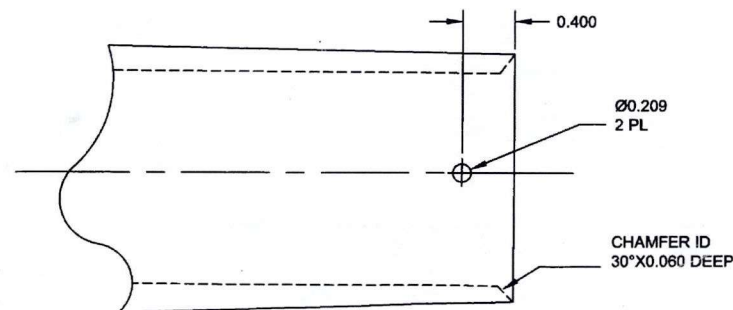

DETAIL EE
SCALE 2X

NOTES:
1) USE INDUSTRY STANDARD NUT PLATE DRILL JIG IF REQUIRED.

RELEASED
2016-04-28

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.		D3391	SHEET 11 OF 11
APPROVED		TITLE	SCALE
DE APPR.		AFT TUBE ASSEMBLY	NTS
DATE	16.01.14	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor		
			QC / QA Coordinator		
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details: _____					